

IQ Plus® 210

*Digital Weight Indicator
Version 1*

Installation Manual



© Rice Lake Weighing Systems. All rights reserved.

Rice Lake Weighing Systems® is a registered trademark of
Rice Lake Weighing Systems.

All other brand or product names within this publication are trademarks or
registered trademarks of their respective companies.

All information contained within this publication is, to the best of our knowledge, complete and
accurate at the time of publication. Rice Lake Weighing Systems reserves the right to make
changes to the technology, features, specifications and design of the equipment without notice.

The most current version of this publication, software, firmware and all other product
updates can be found on our website:

www.ricelake.com

Revision History

This section tracks and describes manual revisions for awareness of major updates.

Revision	Date	Description
C	September 20, 2022	Updated formatting and regulatory notes
D	August 19, 2025	Updated replacement parts

Table i. Revision Letter History



Technical training seminars are available through Rice Lake Weighing Systems. Course descriptions and dates can be viewed at www.ricelake.com/training or obtained by calling 715-234-9171 and asking for the training department.

Contents

1.0 Introduction	7
1.1 Overview	7
1.2 Operating Modes	7
1.3 Front Panel	8
1.4 LED Annunciators	8
1.5 Indicator Operations	8
2.0 Installation	9
2.1 Unpacking and Assembly	9
2.2 Factory Setup	9
2.3 Indicator	10
2.3.1 Cable Connections	10
2.3.2 Load Cells	11
2.3.3 Setting the Load Cell Compensation Jumper	11
2.3.4 Serial Communications	12
2.3.5 Digital Inputs	12
2.3.6 Enclosure Reassembly	12
2.3.7 Board Removal	12
2.4 IQ Plus 210 Indicator Repair Parts	13
3.0 Configuration	16
3.1 Configuration Methods	16
3.1.1 Revolution Configuration	16
3.1.2 EDP Command Configuration	17
3.1.3 Front Panel Configuration	17
3.2 Menu Structures and Parameter Descriptions	20
3.2.1 Configuration Menu	20
3.2.2 Format Menu	21
3.2.3 Calibration Menu	22
3.2.4 Serial Menu	23
3.2.5 Digital Input Menu	24
3.2.6 Default Menu	24
3.2.7 Version Menu	24
4.0 Calibration	25
4.1 Front Panel Calibration	25
4.2 EDP Command Calibration	26
4.3 Revolution™ Calibration	27
5.0 EDP Commands	28
5.1 The EDP Command Set	28
5.1.1 Key Press Commands	28
5.1.2 Reporting Commands	28
5.1.3 The RESETCONFIGURATION Command	28
5.1.4 Parameter Setting Commands	29
5.1.5 Normal Mode Commands	30
5.2 Saving and Transferring Data	30
5.2.1 Saving Indicator Data to a Personal Computer	30
5.2.2 Downloading Configuration Data from PC to Indicator	30



Rice Lake continually offers web-based video training on a growing selection of product-related topics at no cost. Visit www.ricelake.com/webinars

6.0 Appendix	31
6.1 Error Messages	31
6.1.1 Displayed Error Messages	31
6.1.2 Using the XE EDP Command	31
6.2 Status Messages	32
6.2.1 Using the P EDP Command	32
6.2.2 Using the ZZ EDP Command	32
6.3 Continuous Output (Stream) Format	33
6.4 Cable Specifications	33
6.5 Specifications	34



Technical training seminars are available through Rice Lake Weighing Systems.
 Course descriptions and dates can be viewed at www.ricelake.com/training
 or obtained by calling 715-234-9171 and asking for the training department.

DISCONTINUED



Rice Lake continually offers web-based video training on a growing selection of product-related topics at no cost. Visit www.ricelake.com/webinars

1.0 Introduction

This manual is intended for use by service technicians responsible for installing and servicing the IQ Plus® 210 digital weight indicator.

Configuration and calibration of the indicator can be accomplished using the indicator front panel keys, the EDP command set, or Version 2.3 or later of the Revolution™ configuration utility. See [Section 3.1 on page 16](#) for information about configuration methods.



WARNING: Some procedures described in this manual require work inside the indicator enclosure. These procedures are to be performed by qualified service personnel only.



Manuals are available from Rice Lake Weighing Systems at www.ricelake.com/manuals

Warranty information is available at www.ricelake.com/warranties

1.1 Overview

The IQ Plus 210 is a single-channel digital weight indicator housed in a NEMA 4X indoor use only stainless steel enclosure. The indicator front panel consists of a large (.8 in, 20 mm), six-digit, seven-segment LED display, seven LED annunciators, and two piezo switches used to zero the scale and select the displayed units. Features include:

- Drives up to four 350Ω load cells
- Supports 4- and 6-wire load cell connections
- Two configurable digital inputs
- Single serial port supports full duplex, RS-232 communications at up to 9600 bps
- Available in 115 VAC and 230 VAC versions

1.2 Operating Modes

The IQ Plus 210 has two modes of operation:

Weigh mode

Weigh mode is the production mode of the indicator. The indicator displays the gross weight and the LED annunciators indicate scale status and the type of weight value displayed. Once configuration is complete and a legal seal is affixed to the back of the indicator, this is the only mode in which the IQ Plus 210 can operate.

Setup mode

Most of the procedures described in this manual require the indicator to be in setup mode, including configuration and calibration.

To enter setup mode, remove the large fillister head screw from the enclosure backplate. Insert a screwdriver or a similar tool into the access hole and press the setup switch once. The indicator display changes to show the word **CONFIG**.

1.3 Front Panel

Figure 1-1 shows the IQ Plus 210 LED annunciators, buttons, and normal mode key functions.

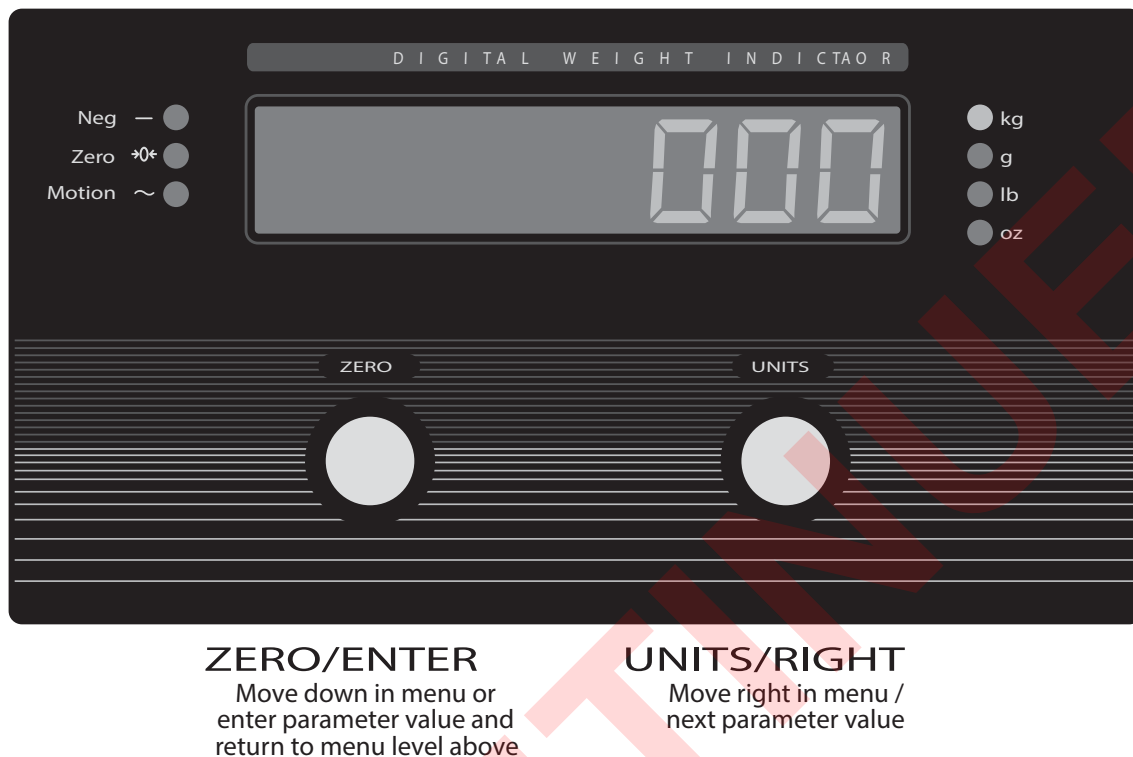


Figure 1-1. IQ Plus 210 Front Panel

1.4 LED Annunciators

The IQ Plus 210 display uses a set of seven LED annunciators to provide additional information about the value being displayed:

- **Neg** annunciator lights to show that the displayed value is negative.
- **Zero**: Weight is within 0.25 graduations of zero. This annunciator lights when the scale is zeroed.
- **Motion**: Scale in motion outside the specified motion band. Zeroing and print operations can only be done when the motion LED is off.
- **lb**, **kg**, **oz**, and **g** annunciators indicate the units associated with the displayed value: lb = pounds, kg = kilograms, oz = ounces, g = grams. **lb** and **oz** annunciators are both lit when the displayed weight is in pounds and ounces.

1.5 Indicator Operations

Basic IQ Plus 210 operations are summarized below.

Zero Scale

1. Remove material from the scale and wait for the **Motion** LED to go out.
2. Press the **ZERO** button. The **zero** annunciator lights to indicate the scale is zeroed.

Change Display Units

Press the **UNITS** button to change the displayed units between primary and alternate units. The LED annunciators on the right side of the display show the current displayed units. If more than one alternate unit is configured, the display cycles through the alternate units before returning to primary units; if no alternate units are configured, the display does not change when the button is pressed.

2.0 Installation

The *IQ plus 210* digital weight indicator is designed for easy setup and installation. All models are pre-configured and weight calibrated before shipment, with the load cell connected to the indicator. For simple, standalone scale applications, hardware installation consists of attaching the indicator, mounting assembly, and bench scale, then leveling the scale.



NOTE: The *IQ plus 2100* is weight calibrated before shipment from the factory, but recalibration at the installation site is strongly recommended. Calibration by a certified scale technician is required for Legal-for-Trade applications.

2.1 Unpacking and Assembly

Immediately after unpacking, visually inspect the *IQ plus 210* to ensure all components are included and undamaged. The shipping carton should contain the indicator, the indicator mount (tilt stand) and a parts kit. If any parts were damaged in shipment, notify Rice Lake Weighing Systems and the shipper immediately.

The parts kit contains the items listed below:

- Capacity label (PN 42350)
- One grounding clamp (PN 53075), external tooth lock washer, (PN 15133), and kep nut (PN 14626) for digital input or serial cable shield grounding against the enclosure.
- Two wing knobs with nylon washers for attaching the indicator to the mounting assembly, four rubber tilt stand feet (for tilt stand option) or bench scale feet, jam nuts, lock washers, and cap screws (for column and attachment bracket options).

To install, attach the mounting assembly to scale base, then assemble the indicator to the mounting assembly. Place the bench scale in the desired location then lift off the scale platter and locate the bubble level. Adjust the corner feet until the scale is level and all feet are in contact with the support surface. Tighten the jam nuts against the scale to lock-in the level adjustment.

Plug power cord into power outlet to begin weighing.



WARNING: The supply cord serves as the power disconnect for the *IQ plus 2100*. The power outlet supplying the indicator must be installed near the unit and be easily accessible.

2.2 Factory Setup

The *IQ plus 210* is pre-configured and weight calibrated at the factory before shipment. Table 2-1 lists the default graduations and count-by configuration for each scale capacity.

Scale Capacity	Count by	Configuration Parameters	
		DECPNT	DSPDIV
5 lb	0.001 lb	888.888	1D
10 lb	0.002 lb	888.888	2D
25 lb	0.005 lb	888.888	5D
50 lb	0.01 lb	8888.88	1D
100 lb	0.02 lb	8888.88	2D
2.5 Kg	0.0005 Kg	88.8888	5D
5 Kg	0.001 Kg	888.888	1D
10 Kg	0.002 Kg	888.888	2D
25 Kg	0.005 Kg	888.888	5D
50 Kg	0.01 Kg	8888.88	1D
 NOTE: All capacities are pre-configured for 5000 graduations (GRADS parameter on CONFIG menu set to 5000).			

Table 2-1. Default Scale Configurations

If scale configuration must be changed, see [Section 3.0 on page 16](#) for detailed configuration information. See [Section 4.0 on page 25](#) for calibration instructions.

2.3 Indicator

The indicator enclosure must be opened to connect cables for load cells, communications and digital inputs.



WARNING: The IQ plus 210 has no on/off switch. Before opening the unit, ensure the power cord is disconnected from the power outlet.

Use a wrist strap to ground yourself and protect components from electrostatic discharge (ESD) when working inside the indicator enclosure.

This unit uses double pole/neutral fusing which could create an electric shock hazard. Procedures requiring work inside the indicator must be performed by qualified service personnel only.

The supply cord serves as the power disconnect for the IQ plus 210. The power outlet supplying the indicator must be installed near the unit and be easily accessible.

Ensure power to the indicator is disconnected, then remove the screws that hold the backplate to the enclosure body, then lift the backplate away from the enclosure and set it aside.

2.3.1 Cable Connections

The IQ plus 210 provides three cord grips for cabling into the indicator: two for the power cord and load cell cabling, the third for communications and digital input cables. The free cord grip comes with a plug installed to prevent moisture from entering the enclosure. If your application requires serial communication or digital input cabling, remove the plug and install cables as described in Sections [Section 2.3.4](#) and [Section 2.3.5 on page 12](#).

Cable Grounding

Except for the power cord, all cables routed through the cord grips should be grounded against the indicator enclosure. Do the following to ground shielded cables:

- Use the lock washers, clamps, and keps provided in the parts kit to install grounding clamps on the studs adjacent to the cord grips. Install grounding clamps only for cord grips that will be used; do not tighten nuts.
- Route cables through cord grips and grounding clamps to determine cable lengths required to reach cable connectors. Mark cables to remove insulation and shield as described below:
- For cables with foil shielding, strip insulation and foil from the cable 0.5" (15 mm) past the grounding clamp (see [Figure 2-1](#)). Fold the foil shield back on the cable where the cable passes through the clamp. Ensure silver (conductive) side of foil is turned outward for contact with the grounding clamp.
- For cables with braided shielding, strip cable insulation and braided shield from a point just past the grounding clamp. Strip another 0.5" (15 mm) of insulation **only** to expose the braid where the cable passes through the clamp (see [Figure 2-1](#)).
- For load cell cables, strip the yellow shield wire 0.75" past the grounding clamp. Fold wire back and secure between the cable and clamp. Shield wire function is provided by contact between the cable shield and the grounding clamp.
- Route stripped cables through cord grips and clamps. Ensure shields contact grounding clamps as shown in [Figure 2-1](#). Tighten grounding clamp nuts.
- Finish installation using cable mounts and ties to secure cables inside of indicator enclosure.

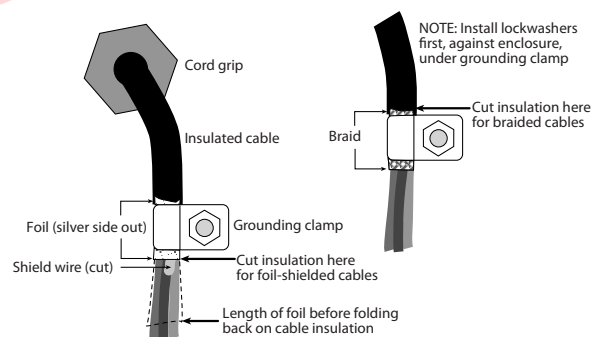


Figure 2-1. Grounding Clamp Attachment for Foil-Shielded and Braided Cables

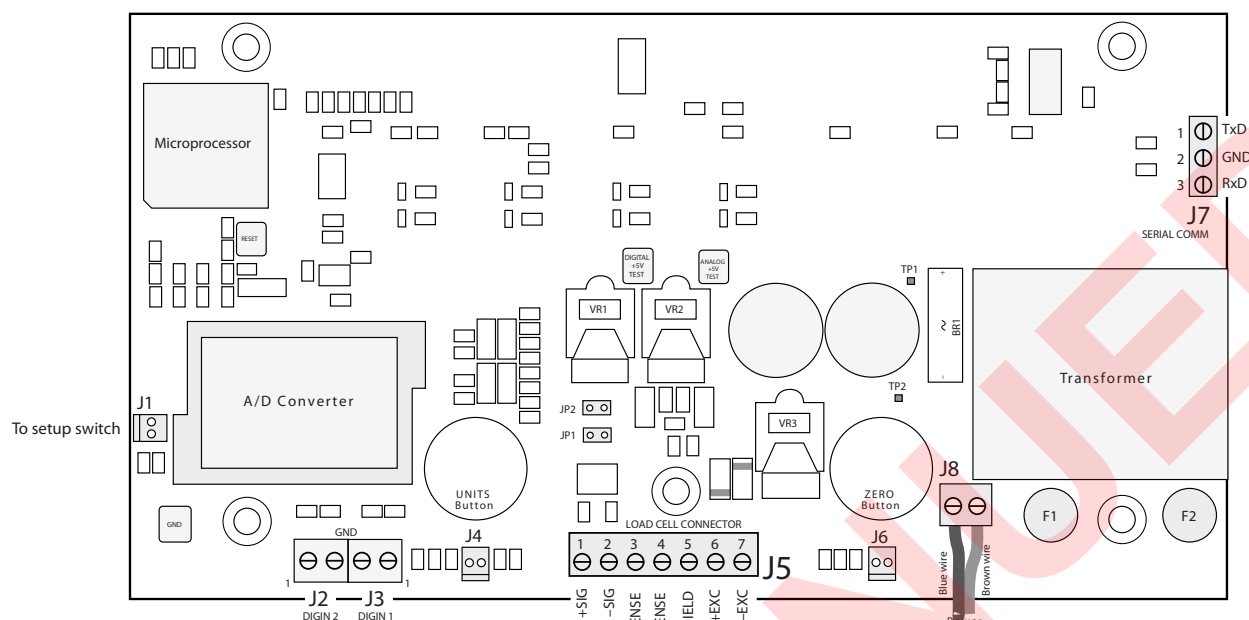


Figure 2-2. IQ plus 210 CPU and Power Supply Board

2.3.2 Load Cells

Wire the load cell cable from the load cell or junction box to connector J5 as shown in Table 2-2. If using 6-wire load cell cable (with sense wires), remove jumpers JP1 and JP2 (see Figure 2-2). For 4-wire installation, leave jumpers JP1 and JP2 on.



NOTE: All models come with ten feet of color-coded load cell cable. Do not cut this cable. The load cell is temperature-compensated for an exact cable length often feet. Cutting the load cell cable voids the load cell warranty.

When connections are complete, use two cable ties to secure the load cell cable to the inside of the enclosure.

J5 Pin	Function	RL1040 RL1042	RL1380
1	+SIG	Red	White
2	-SIG	White	Red
3	+SENSE	Blue	--
4	-SENSE	Brown	--
5	+EXC	Green	Green
6	-EXC	Black	Black

Table 2-2. J5 Pin Assignments and Load Cell Wire Color



NOTE: Use grounding procedure described in Section 2.3.1 on page 10 to attach shield wire to backplate.

For 6-wire connections, remove jumpers JP1 and JP2.

2.3.3 Setting the Load Cell Compensation Jumper

The load cell compensation jumper (above the ZERO button location on the CPU board; see Figure 2-2) must be set for the type of load cell connected to the indicator:

- For load cells with balanced bridges, set the jumper in the OFF position. Example of balanced load cells include the RL1040, RL1250, RL1260, RL1380, and RL1385.
- For load cells with unbalanced bridges, follow the procedure below to determine the correct jumper position. Examples of unbalanced cells include the RL1042 and RL1010.

To determine the correct jumper position for unbalanced cells, do the following;

1. Disconnect load cell from indicator.
2. Use an ohmmeter to measure +EXC to +SIG and +EXC to -SIG. Measured values between the excitation line and each of the signal lines should be within $2-3\Omega$.

- Next, measure –EXC to +SIG and –EXC to –SIG. Measured values between the excitation line and each of the signal lines should be within 2–3Ω.
- If the +EXC measurements (step 2) are 5% larger than the –EXC measurements (step 3), set the compensation jumper in the ON position. If the +EXC measurements are < 5% greater (or are less) than the –EXC measurements, set the jumper in the OFF position.

2.3.4 Serial Communications

To attach serial communications cables, connect communications cables to connector J7 as shown in Table 2-3. Use cable ties to secure serial cable to the inside of the enclosure.

Use the SERIAL menu to configure serial communications. See [Section 3.2.4 on page 23](#) for configuration information.

J7 Pin	Label	Function
1	TxD	RS-232 TxD
2	GND	RS-232 Ground
3	RxD	RS-232 RxD

Table 2-3. J7 Pin Assignments

2.3.5 Digital Inputs

Digital inputs (connectors J2 and J3) can be used to perform remote ZERO and UNITS key presses or to send serial data to a printer (remote PRINT key function). The inputs are active (on) with low voltage (0 VDC) and can be driven by TTL or 5V logic without additional hardware. Use the DIG IN menu to configure the digital inputs. See [Section 3.2.5 on page 24](#) for information about configuring the digital inputs.

2.3.6 Enclosure Reassembly

Once cabling is complete, position the backplate over the enclosure and reinstall the backplate screws. Use the torque pattern shown in [Figure 2-3](#) to prevent distorting the backplate gasket. Torque screws to 15 in-lb (1.7 N-m).

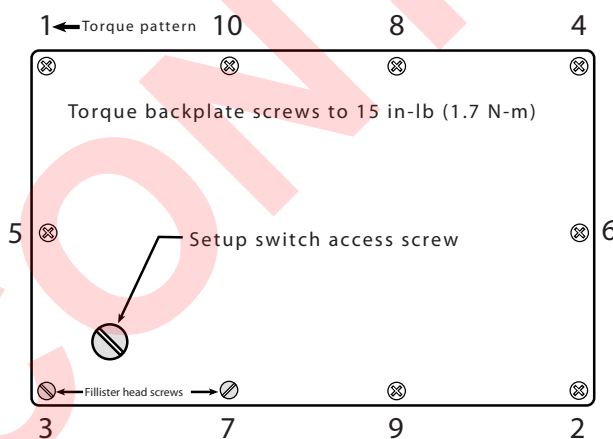


Figure 2-3. IQ plus 210 Enclosure Backplate

2.3.7 Board Removal

If you must remove the IQ plus 210 CPU board, use the following procedure:

- Disconnect power to the indicator. Remove backplate as described in [Section 2.3 on page 10](#).
- Remove connections to J5 (load cell cable), J7 (serial communications), J2 and J3 (digital inputs), J4 and J6 (piezo button inputs), and J1 (setup switch). Remove blue and brown power input wires at J8. See [Figure 2-2 on page 11](#) for connector locations.
- Remove the five nuts from the CPU board, then lift the board out of the enclosure.

To replace the CPU board, reverse the above procedure. Be sure to reinstall cable ties to secure all cables inside the indicator enclosure.

2.4 IQ Plus 210 Indicator Repair Parts

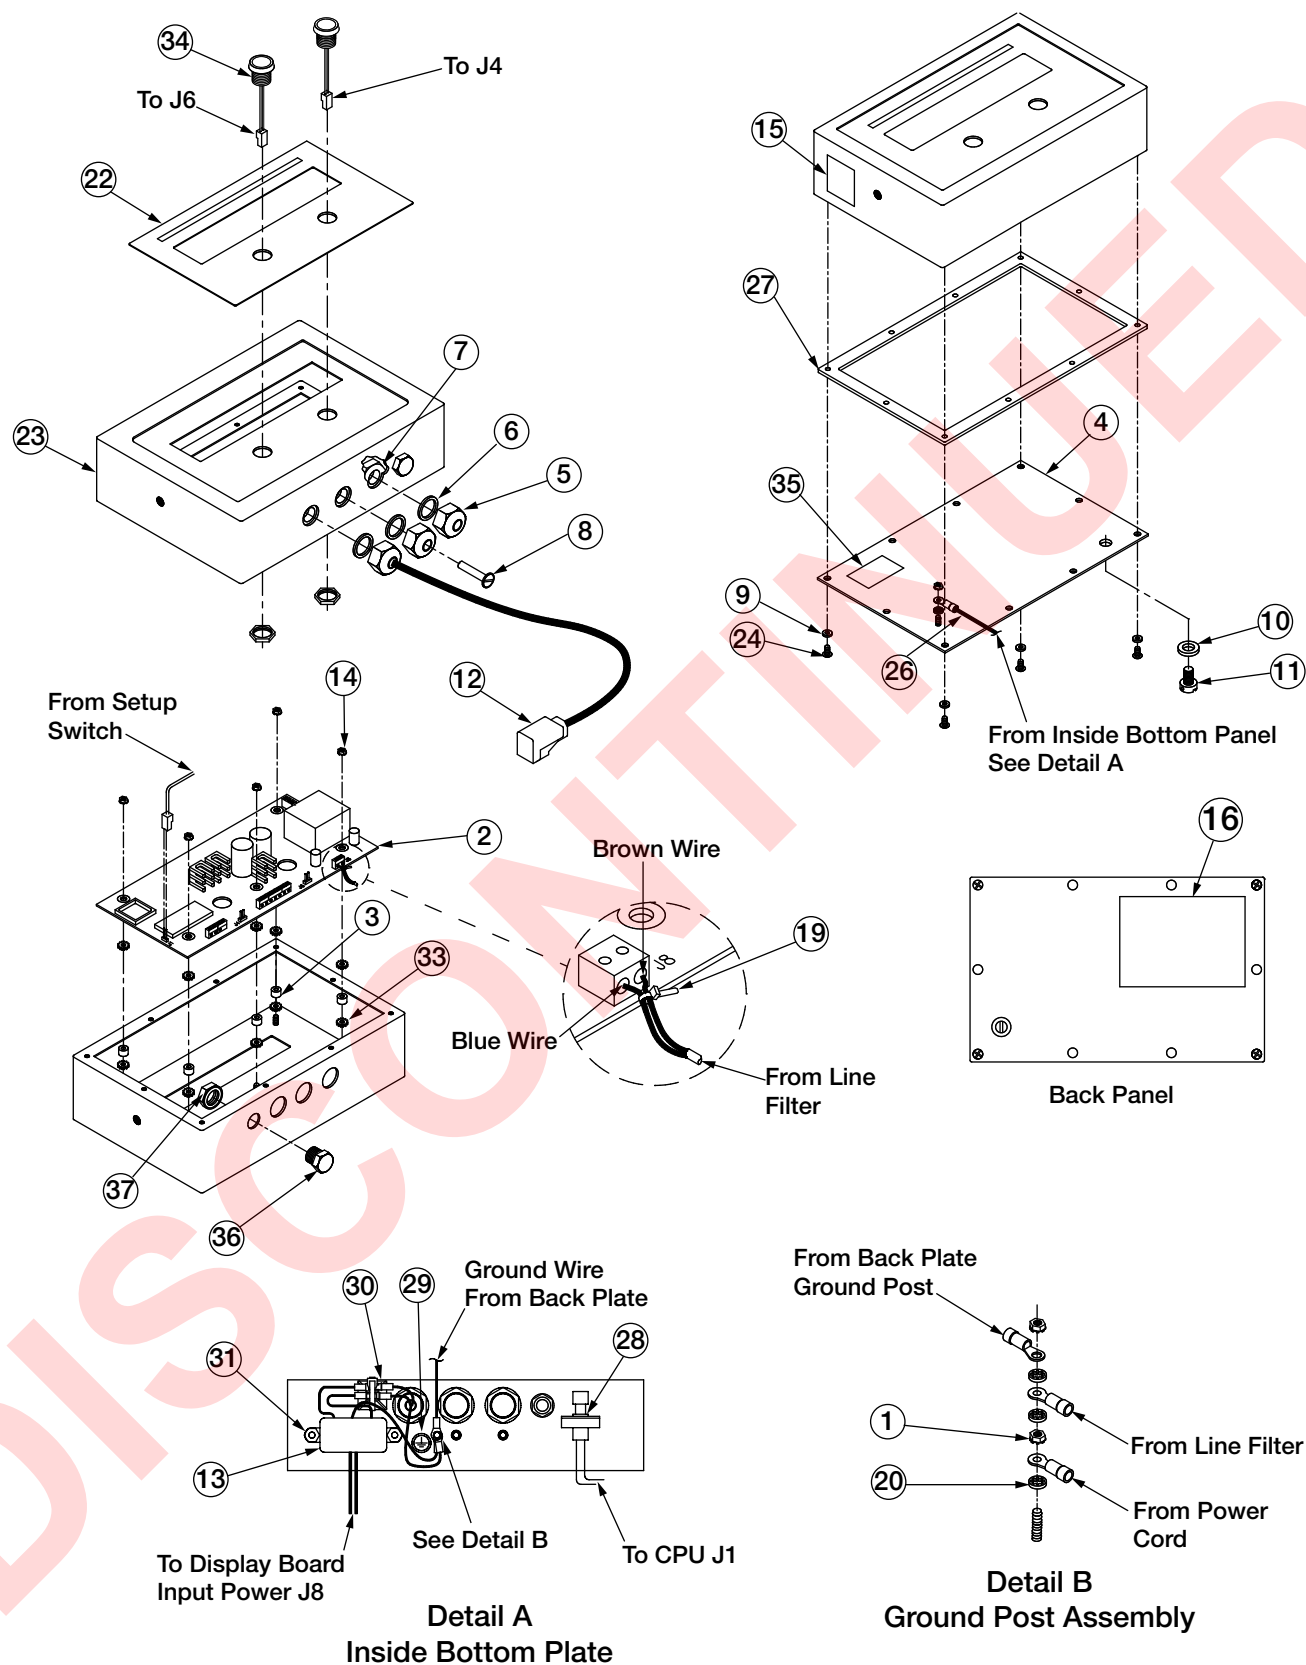


Figure 2-4. IQ Plus 210 Indicator Parts Illustration

Item No.	Part No.	Description	Qty
1	14626	Kep nuts, 8-32NC hex	3
2	53651	Display and CPU board assembly, 115 VAC	1
	53650	Display and CPU board assembly, 230 VAC	1
3	15365	Board mounting spacers	5
4	52483	Enclosure backplate	1
5	15626	Cable grips, PG9	2
6	30375	Nylon seal rings for cable grips	3
7	15627	Locknuts, PCN9	3
8	19538	Cable grip plugs	2
9	45042	Sealing washers	1/4
10	44676	Sealing washer for setup switch access screw	1
11	42640	Setup switch access screw, 1/4 x 28NF x 1/4	1
12	41965	Power cord assembly, 115VAC	1
	45254	Power cord assembly, 230VAC	1
13	41964	Line filter assembly	1
14	14621	Kep nuts, 6-32NC hex	5
20	15134	Lock washers, internal tooth, No. 8 , Type A	4
22	52853	Overlay membrane panel	1
23	52482	Enclosure	1
24	14862	Screws, 8-32NC x 3/8	8/4
26	45043	Ground wire, 4-in., No. 8	1
27	39037	Backplate gasket	1
28	49910	Setup switch assembly	1
29	16892	Ground/Earth Label	1
30	15650	Cable tie mounts	1
31	45302	Line filter standoffs	2
33	15131	Lock washers, external tooth, No. 6, Type A	10
34	61113	Piezo switches	2
35	30623	Fillister head screws, 8-32NC x 7/16	2
36	182479	Vent, Metal Breather Membrane in M12x1.5 SST Chassis	1
37	182480	Nut, Metal Breather Vent M12x1.5	1
—	53848	200 mA TR5 subminiature fuses, 115 VAC	2
	53881	100 mA TR5 subminiature fuses, 230 VAC	2

Table 2-4. IQ Plus 210 Repair Parts List



WARNING: For protection against risk of fire, replace fuses only with same type and rating fuse.

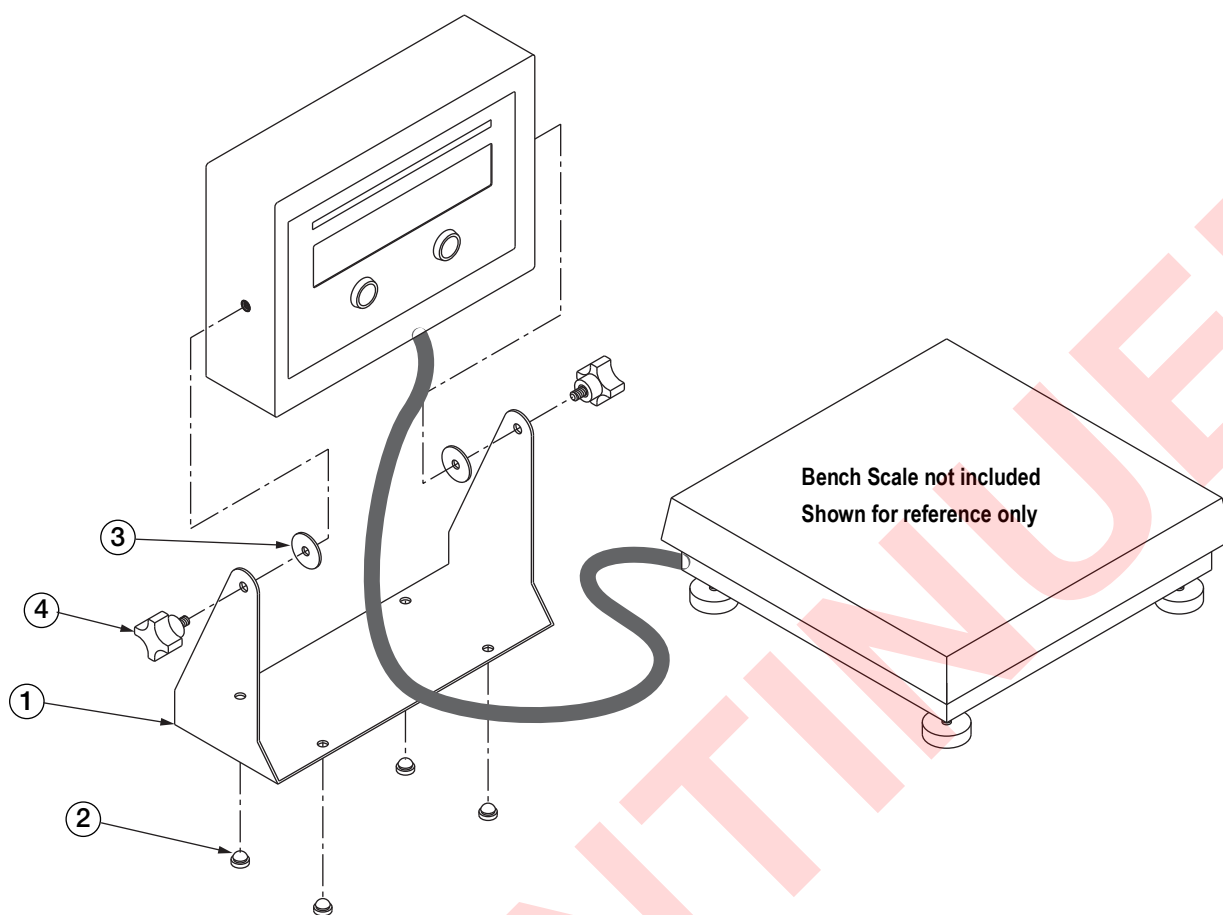


Figure 2-5. IQ Plus 210 Tilt Stand Assembly

Item No.	Part No.	Description	Qty
1	29635	Tilt stand	1
2	42149	Tilt stand feet	4
3	15144	Nylon washers, 1/4x1x1/16	2
4	30342	Wing knobs	2

Table 2-5. IQ Plus 210 Tilt Stand Assembly Parts List

3.0 Configuration

To configure the IQ Plus 210 indicator, the indicator must be placed in setup mode. The setup switch is accessed by removing the large fillister head screw on the enclosure backplate. Insert a screwdriver into the access hole and press the switch to enter setup mode.

When the indicator is placed in setup mode, the word **CONFIG** is shown on the display. The **CONFIG** menu is the first of the main menus used to configure the indicator. Detailed descriptions of these menus are given in [Section 3.2 on page 20](#). When configuration is complete, press the setup switch again to exit setup mode, then replace the setup switch access screw.

3.1 Configuration Methods

The IQ Plus 210 indicator can be configured by using the front panel buttons to navigate through a series of configuration menus or by sending commands or configuration data to the EDP port. Configuration using the menus is described in [Section 3.1.3 on page 17](#).

Configuration using the EDP port can be accomplished using either the EDP command set described in [Section 5.0 on page 28](#) or Version 2.3 or later of the Revolution™ configuration utility.

3.1.1 Revolution Configuration

The Revolution configuration utility provides the preferred method for configuring the IQ Plus 210 indicator. Revolution runs on a personal computer to set configuration parameters for the indicator. When Revolution configuration is complete, configuration data is downloaded to the indicator.

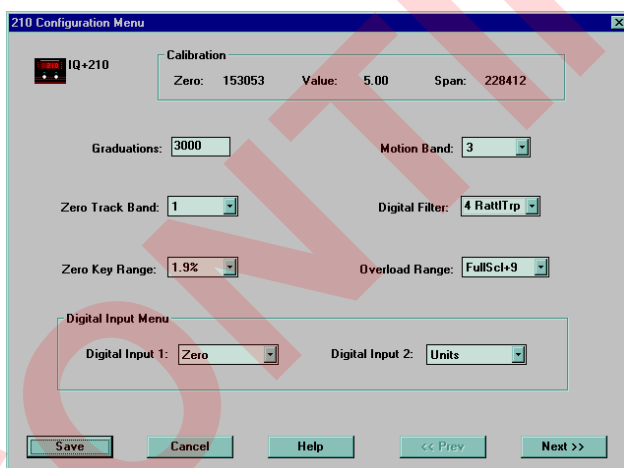


Figure 3-1. Sample Revolution Display

Revolution supports both uploading and downloading of indicator configuration data. This capability allows configuration data to be retrieved from one indicator, edited, then downloaded to another.

To use Revolution, do the following:

1. Install Revolution on an IBM-compatible personal computer running Windows® 3.11 or Windows 95. Minimum system requirements are 8MB of extended memory and at least 5MB of available hard disk space.
2. With both indicator and PC powered off, connect the PC serial port to the RS-232 pins on the indicator EDP port.
3. Power up the PC and the indicator. Use the setup switch to place the indicator in setup mode.
4. Start the Revolution program.

[Figure 3-1](#) shows an example of one of the Revolution configuration displays.

Revolution provides online help for each of its configuration displays. Parameter descriptions provided in this manual for front panel configuration can also be used when configuring the indicator using Revolution: the interface is different, but the parameters set are the same.

3.1.2 EDP Command Configuration

The EDP command set can be used to configure the IQ Plus 210 indicator using a personal computer, terminal, or remote keyboard. Like Revolution, EDP command configuration sends commands to the indicator serial port; unlike Revolution, EDP commands can be sent using any external device capable of sending ASCII characters over a serial connection.


EDP commands duplicate the functions available using the indicator front panel and provide some functions not otherwise available. EDP commands can be used to simulate pressing front panel buttons, to configure the indicator, or to dump lists of parameter settings. See [Section 5.0 on page 28](#) for more information about using the EDP command set.

3.1.3 Front Panel Configuration

The IQ Plus 210 indicator can be configured using a series of menus accessed through the indicator front panel when the indicator is in setup mode. Table 3-1 summarizes the functions of each of the main menus.

Menu		Menu Function
CONFIG	Configuration	Configure grads, zero tracking, zero range, motion band, overload, and digital filtering parameters.
FORMAT	Format	Set format of primary units, select alternate display units.
CALIBR	Calibration	Calibrate indicator. See Section 4.0 on page 25 for calibration procedures.
SERIAL	Serial	Configure serial port.
DIG IN	Digital Input	Assign digital input functions.
DEFLT	Default	Restore default configuration.
VERS	Version	Display installed software version number.

Table 3-1. IQ Plus 210 Menu Summary

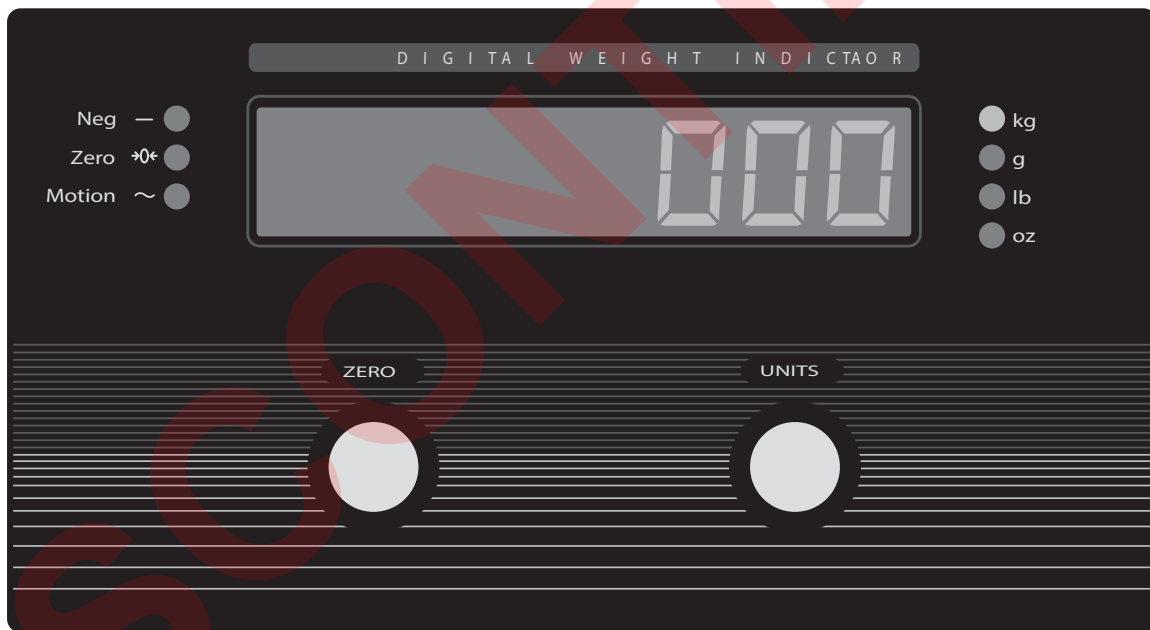

ZERO/ENTER

Move down in menu or enter parameter value and return to menu level above

UNITS/RIGHT

Move right in menu / next parameter value

Figure 3-2. Front Panel Key Functions in Setup Mode

Front Panel Menu Navigation

The front panel buttons are used to navigate through the menus in setup mode (see [Figure 3-2](#)). The **UNITS (RIGHT)** button scrolls right (horizontally) on the same menu level; the **ZERO (ENTER)** button moves down (vertically) to different menu levels and serves as an Enter key for selecting parameter values within the menus.

Most of the configuration menus have three or four levels. [Figure 3-3](#) shows the general structure of the IQ Plus 210 configuration menus. Note the following:

- On the first (main) menu level, press **RIGHT** to scroll through the menus. Pressing **RIGHT** from the **VERS** menu wraps around to the **CONFIG** menu. Press **ENTER** from any of the main menus to move down to the first parameter for that menu.
- On the middle (parameter) menu levels, press **RIGHT** to scroll through the parameter prompts for the menu. When the last parameter is displayed, pressing **RIGHT** returns to the level above. Press **ENTER** from any parameter prompt to move down to the values prompts for that parameter.
- On the bottom (parameter value) menu level, press **RIGHT** to scroll through the values for the parameter. Pressing **RIGHT** from the last value wraps around to first value. Press **ENTER** to select the value and return to the parameter prompt.

To edit numerical values, use the **RIGHT** button to select the digit; use the **ENTER** button to increment or decrement the value of the flashing digit (see [Figure 3-5 on page 19](#)). Once all digits have been edited, press **ENTER** to save the value and return to the parameter prompt.

Menu Navigation

General Structure

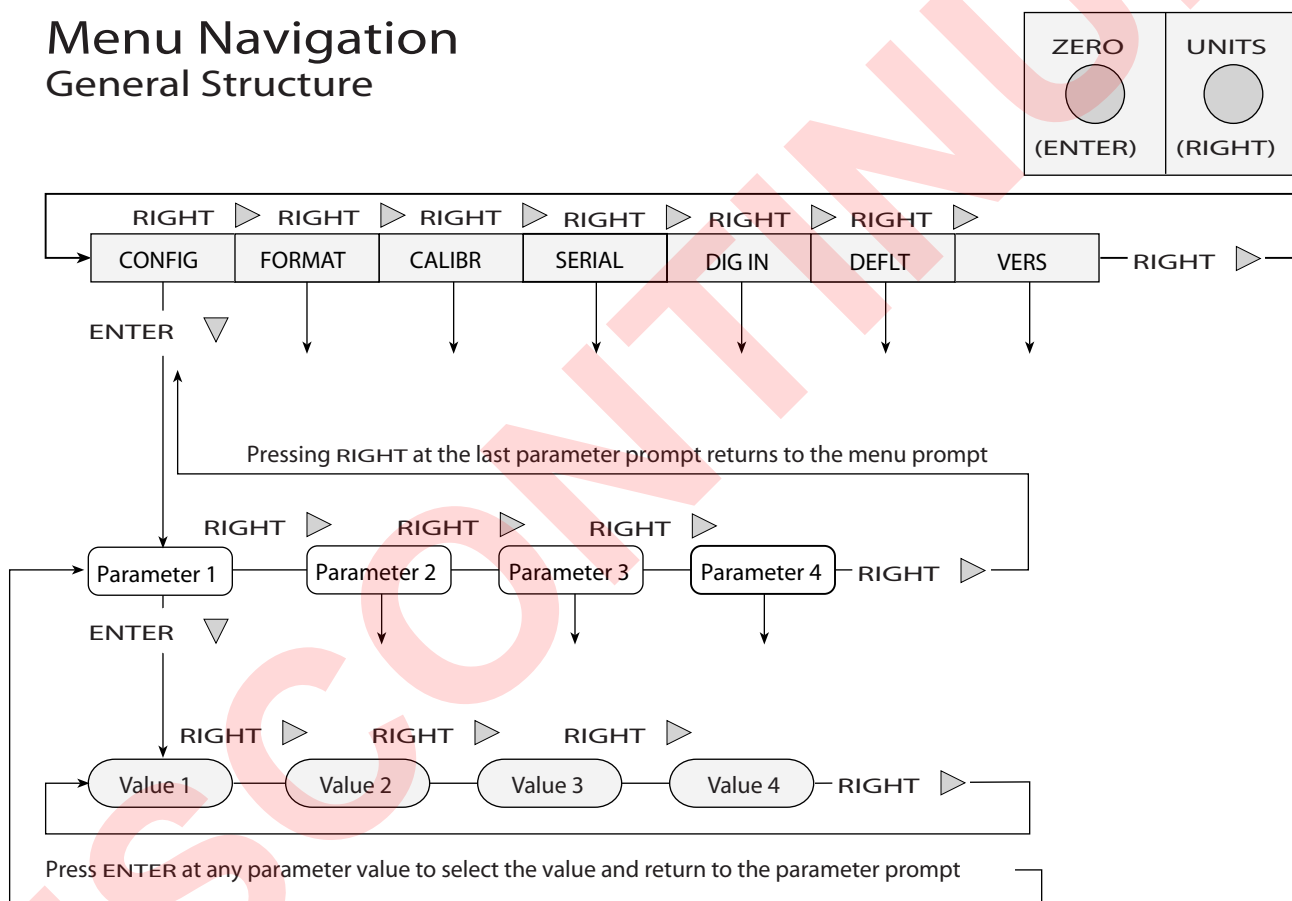


Figure 3-3. General Menu Structure

Menu Navigation Serial Menu Example


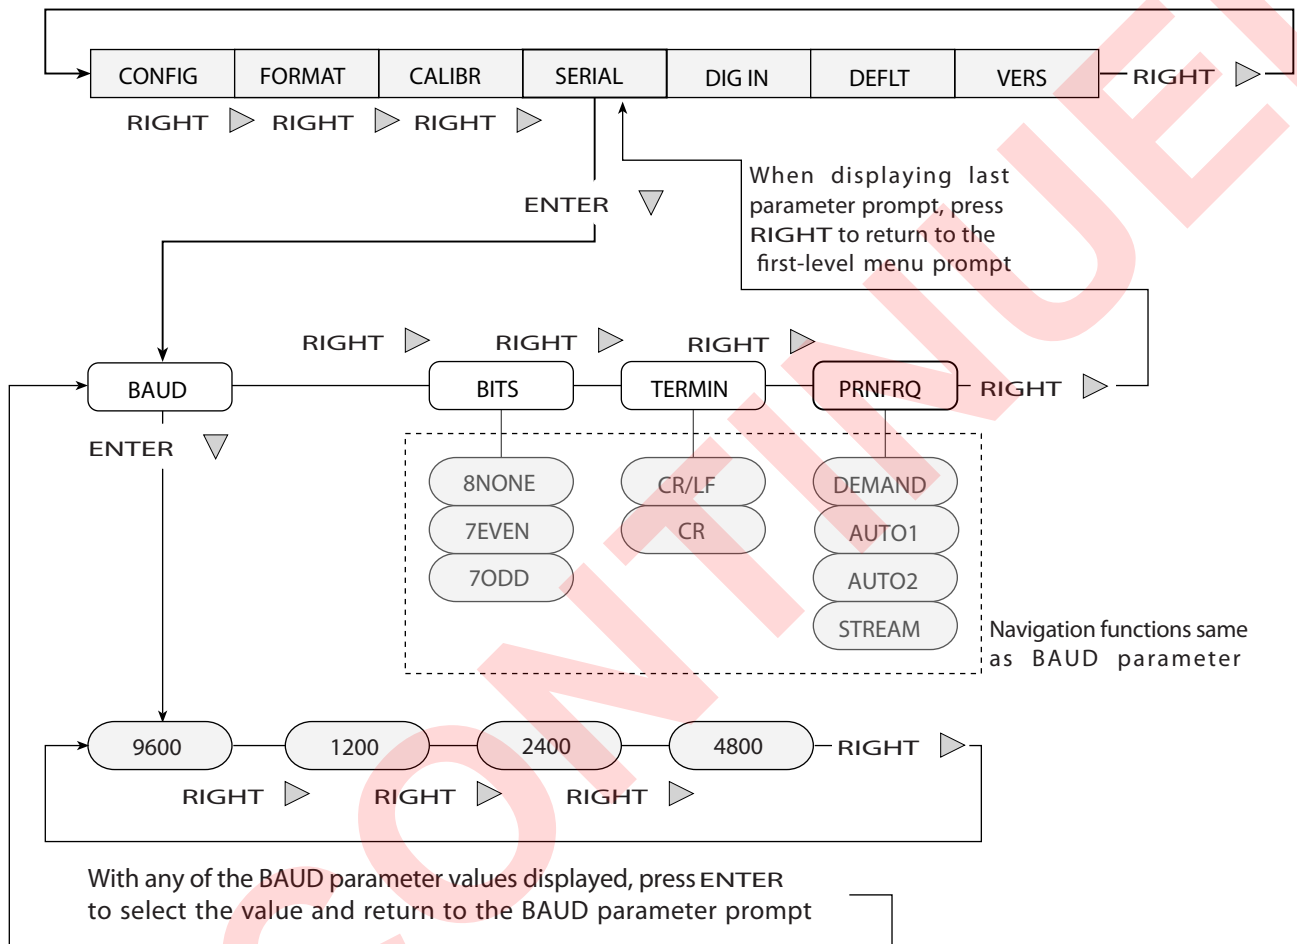


Figure 3-4. Setup Mode Menu Navigation

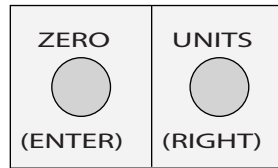

To edit numeric values, press the UNITS (RIGHT) button to select the leftmost digit. Each digit flashes when selected: Press ZERO (ENTER) to increment the value of the selected digit; press the RIGHT button to move right to the next digit.

Once the last digit has been edited, press RIGHT again and the digit stops flashing. Press ENTER to save the value entered and return to the menu level above, or press RIGHT to edit the value again, starting with the leftmost digit.

Figure 3-5. Editing Procedure for Numeric Values

3.2 Menu Structures and Parameter Descriptions

The following sections provide graphic representations of the IQ Plus 210 menu structures. In the actual menu structure, the values under each parameter are arranged horizontally. To save page space, menu choices are shown in vertical columns. The factory default setting appears at the top of each column. Most menu diagrams are accompanied by a table that describes all parameters and parameter values associated with that menu. Default parameter values are shown in bold type.

3.2.1 Configuration Menu

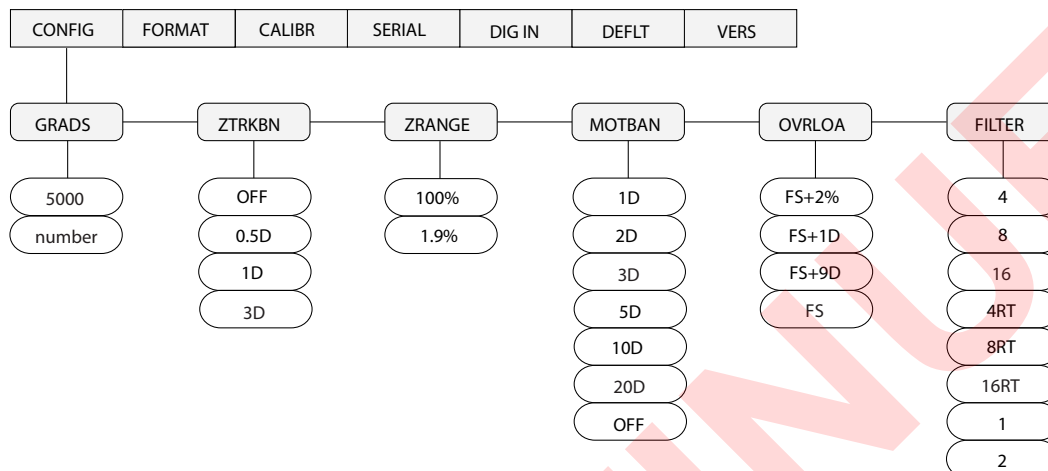


Figure 3-6. Configuration Menu

CONFIG Menu		
Parameter	Choices	Description
Level 2 submenus		
GRADS	5000 number	Graduations. Specifies the number of full scale graduations. The value entered must be in the range 1–10 000 and should be consistent with legal requirements and environmental limits on system resolution. To calculate GRADS, use the formula, $\text{GRADS} = \text{Capacity} / \text{Display Divisions}$. Display divisions for primary and secondary units are specified on the FORMAT menu.
ZTRKBN	OFF 0.5D 1D 3D	Zero track band. Automatically zeroes the scale when within the range specified, as long as the input is within the configured zero range (ZRANGE parameter). Selections are $\pm$ display divisions. Maximum legal value varies depending on local regulations.
ZRANGE	100% 1.9%	Zero range. Selects the range within which the scale can be zeroed. The 1.9% selection is $\pm 1.9\%$ around the calibrated zero point, for a total range of 3.8%. Indicator must be at standstill to zero the scale. Use 1.9% for legal-for-trade applications.
MOTBAN	1D 2D 3D 5D 10D 20D OFF	Motion band. Sets the level, in display divisions, at which scale motion is detected. If motion is not detected for 1 second or more, the standstill symbol lights. Some operations, including print, tare, and zero, require the scale to be at standstill. Maximum legal value varies depending on local regulations. If OFF is selected, ZTRKBN should also be set to OFF.
OVRLOA	FS+2% FS+1D FS+9D FS	Overload. Determines the point at which the display blanks and an out-of-range error message is displayed. Maximum legal value varies depending on local regulations.
FILTER	4 8 16 4RT 8RT 16RT 1 2	Digital filtering. Selects the digital filtering rate used to reduce the effects of mechanical vibration from the immediate area of the scale. Choices indicate the number of A/D conversions that are averaged to obtain the displayed reading. A higher number gives a more accurate display by minimizing the effect of a few noisy readings, but slows down the settling rate of the indicator. Values with the RT suffix provide a raised threshold for filtering larger noise spikes.

Table 3-2. Configuration Menu Parameters

3.2.2 Format Menu

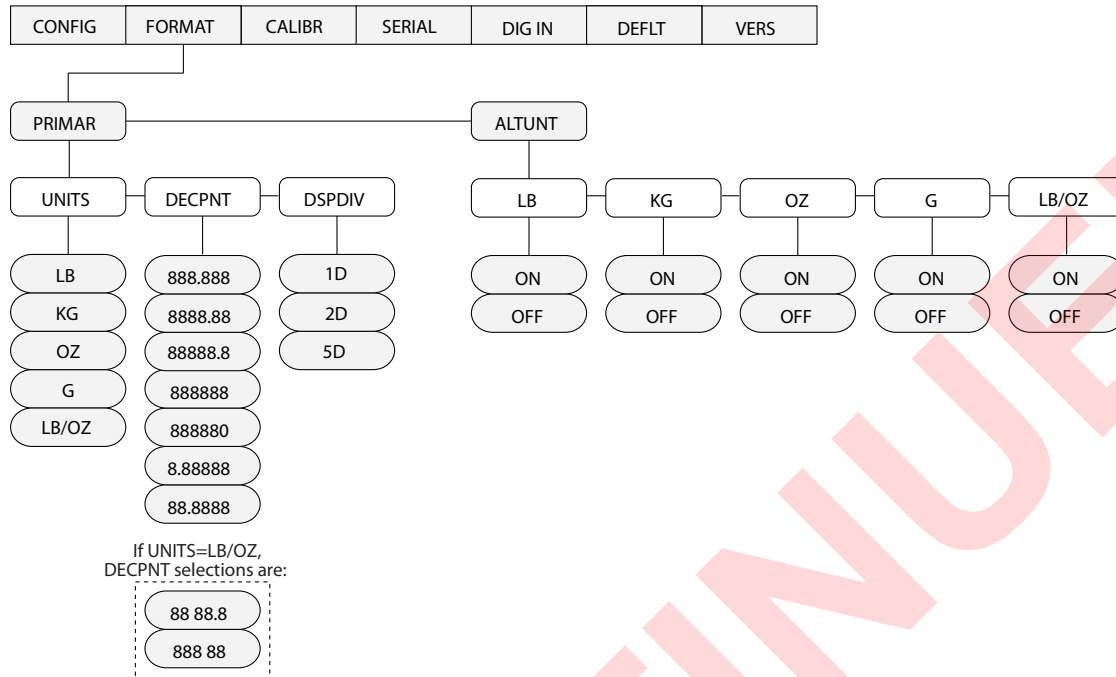


Figure 3-7. Format Menu

FORMAT Menu		
Parameter	Choices	Description
Level 2 submenus		
PRIMAR	UNITS DECPNT DSPDIV	Specifies the decimal position, display divisions, and units used for the primary units. See Level 3 submenu parameter descriptions.
ALTUNT	LB KG OZ G LB/OZ	Specifies which alternate units can be displayed by pressing the UNITS. See Level 3 submenu parameter descriptions. NOTE: The LB/OZ setting is not a Legal-for-Trade setting.
Level 3 submenus		
Primary Units (PRIMAR Parameter)		
DECPNT	888.888 8888.88 88888.8 888888 888880 8.88888 88.8888 or 88 88.8 888 88	Decimal point location. Specifies the location of the decimal point or dummy zeroes in the primary unit display. Value should be consistent with local legal requirements. If LB/OZ is selected as the primary unit, DECPNT selections are 88 88.8 and 888 88.
DSPDIV	1D 2D 5D	Display divisions. Selects the minimum division size for the primary units displayed weight.

Table 3-3. Format Menu Parameters

FORMAT Menu		
Parameter	Choices	Description
UNITS	LB KG OZ G LB/OZ	Specifies primary units for displayed and printed weight. Values are: LB=pound; KG=kilogram; OZ=ounce; G=gram; LB/OZ=pounds and ounces.
Alternate Units (ALTUNT Parameter)		
LB KG OZ G LB/OZ	ON OFF	Alternate units. Determines which units are displayed when the UNITS button is pressed. The value for the primary unit (selected on the PRIMAR parameter) is always ON. NOTE: The LB/OZ setting is not a Legal-for-Trade setting.

Table 3-3. Format Menu Parameters (Continued)

3.2.3 Calibration Menu

See [Section 4.0 on page 25](#) for calibration procedures.

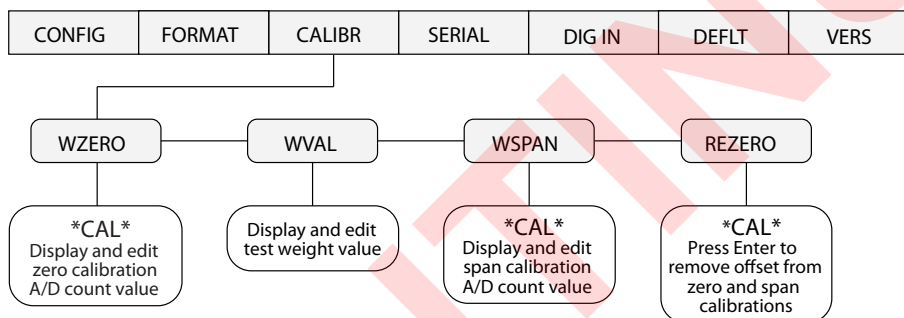


Figure 3-8. Calibration Menu

CALIBR Menu		
Parameter	Choices	Description
Level 2 submenus		
WZERO	—	Display and edit the zero calibration A/D count value.
WVAL	—	Display and edit the test weight value.
WSPAN	—	Display and edit the span calibration A/D count value.
REZERO	—	Press ENTER to remove an offset value from the zero and span calibrations. Use this parameter only after WZERO and WSPAN have been set. See Section 4.0 on page 25 for more information about using this parameter.

Table 3-4. Calibration Menu Parameters

3.2.4 Serial Menu

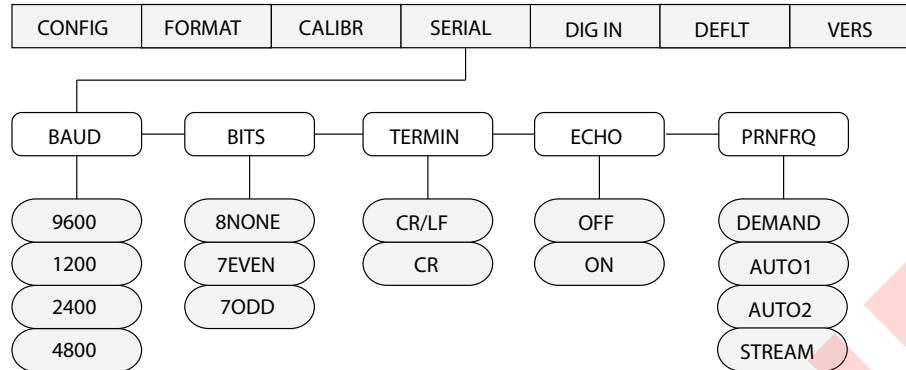


Figure 3-9. Serial Menu

SERIAL Menu		
Parameter	Choices	Description
BAUD	9600 1200 2400 4800	Baud rate. Selects the transmission speed for the serial port.
BITS	8NONE 7EVEN 7ODD	Selects number of data bits and parity of data transmitted from the serial port.
TERMIN	CR/LF CR	Termination character. Selects termination character for data sent from the serial port.
ECHO	OFF ON	This command enables or disables echoing of the serial commands sent to the indicator.
PRNFRQ	DEMAND AUTO1 AUTO2 STREAM	Print frequency. Specifies when the indicator sends data to the serial port: DEMAND: When a PRINT digital input is activated or the KPRINT EDP command received. AUTO1: Output enabled by scale in motion; transmitted when scale returns to standstill. AUTO2: Output enabled by scale at center of zero; transmitted when a positive scale weight is at standstill. STREAM: Continuous output. See Section 6.3 on page 33 for output format. Weight data is sent to the serial port in displayed units except when other units are specified using one of the XGx EDP commands (see Section 5.0 on page 28). If DEMAND, AUTO1, or AUTO2, is selected for this parameter, serial output is formatted as follows: wwwwwww uu GROSS where wwwwwww is a 7-digit weight field (leading zeroes suppressed, including decimal point and minus sign, if required), uu is the units designator (lb, kg, oz, or G). If pounds/ounces (LB/OZ) is specified as the primary units, the serial output is formatted as shown below: xxx lb yyyy oz GROSS where xxx is the three-digit pounds weight (including minus sign, if required) followed by lb and a space; and yyyy is the four-digit ounce weight (including decimal point) followed by oz.

Table 3-5. Serial Menu Parameters

3.2.5 Digital Input Menu

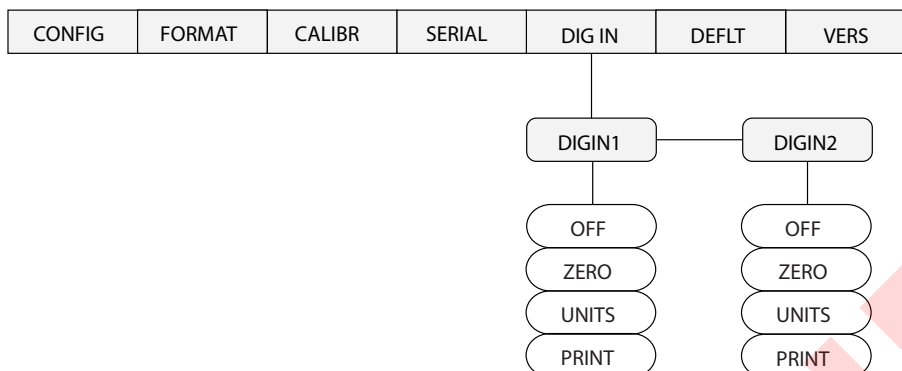


Figure 3-10. Digital Input Menu

DIG IN Menu		
Parameter	Choices	Description
Level 2 submenus		
DIGIN1 DIGIN2	OFF ZERO UNITS PRINT	Specifies the function activated by digital inputs 1 and 2.

Table 3-6. Digital Input Menu Parameters

3.2.6 Default Menu

The DEFLT menu is used to reset indicator configuration to the default values. There are no parameters associated with the DEFLT menu. From the DEFLT menu, press **ENTER (ZERO)** to move down to the **RESET** parameter. Press **ENTER** again to reset the indicator to the default configuration values or press **RIGHT (UNITS)** to cancel the indicator reset and return to the menu level above.

NOTE: All load cell calibration settings are lost when the RESET function is performed.

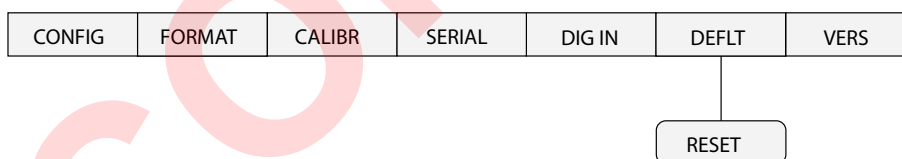


Figure 3-11. Default Menu

3.2.7 Version Menu

The VERS menu is used to check the software version installed in the indicator. There are no parameters associated with the VERS menu: when selected, the indicator displays the installed software version number.

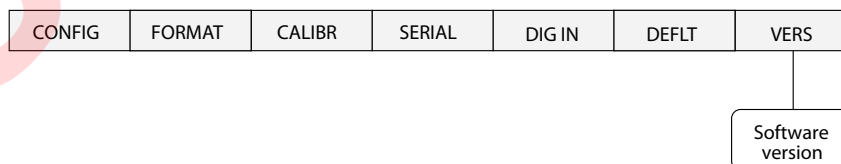


Figure 3-12. Version Menu

4.0 Calibration

The IQ Plus 210 can be calibrated using the front panel, EDP commands, or the Revolution™ configuration utility. Each method consists of the following steps:

- Zero calibration
- Entering the test weight value
- Span calibration
- Optional rezero calibration for test weights using hooks or chains.

The following sections describe the calibration procedure for each of the calibration methods.

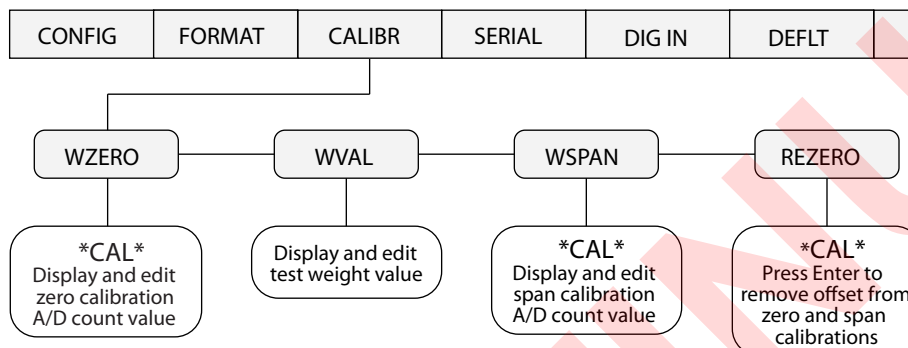


Figure 4-1. Calibration (CALIBR) Menu

4.1 Front Panel Calibration

To calibrate the indicator using the front panel, do the following:

1. Place the indicator in setup mode (display reads **CONFIG**) and remove all weight from the scale platform. If your test weights require hooks or chains, place the hooks or chains on the scale for zero calibration.
2. Press the **RIGHT (UNITS)** button until the display reads **CALIBR** (see Figure 4-1). Press **ENTER (ZERO)** to go to zero calibration (**WZERO**).
3. With **WZERO** displayed, press **ENTER** to calibrate zero. The indicator displays °**CAL**° while calibration is in progress. When complete, the A/D count for the zero calibration is displayed. Press **ENTER** again to save the zero calibration value and return to the **WZERO** prompt or use the procedure shown in Figure 4-2 on page 26 to edit the value. When done, press **RIGHT** to go to the **WVAL** prompt.
4. With **WVAL** displayed, press **ENTER** to show the test weight value. If the value is equal to the test weight you are using, press **ENTER** again to save the value and return to the **WVAL** prompt; if the value is incorrect, use the procedure shown in Figure 4-2 on page 26 to edit the value. When done, press **RIGHT** to go to the **WSPAN** prompt.



NOTE: When calibrating the indicator with **LB/OZ** as the primary unit, enter the **WVAL** value in ounces. For example, to calibrate a 5 lb scale using **LB/OZ**, enter 80 (5 lb x 16 oz/lb) as the **WVAL** value.

5. With **WSPAN** displayed, place test weights on the scale then press **ENTER** to calibrate span. The indicator displays °**CAL**° while calibration is in progress. When complete, the A/D count for the span calibration is displayed. Press **ENTER** again to save the span calibration value and return to the **WSPAN** prompt or use the procedure shown in Figure 4-2 on page 26 to edit the value. When done, press **RIGHT** to go to the **REZERO** prompt.



To edit numeric values, press the **UNITS (RIGHT)** button to select the leftmost digit. Each digit flashes when selected: Press **ZERO (ENTER)** to increment the value of the selected digit; press the **RIGHT** button to move right to the next digit.

Once the last digit has been edited, press **RIGHT** again and the digit stops flashing. Press **ENTER** to save the value entered and return to the menu level above, or press **RIGHT** to edit the value again, starting with the leftmost digit.

Figure 4-2. Editing Procedure for Numeric Values

6. The rezero function is used to remove a calibration offset when hooks or chains are used to hang the test weights.
 - If no other apparatus was used to hang the test weights during calibration, remove the test weights and press **RIGHT** to return to the CALIBR menu.
 - If hooks or chains were used during calibration, remove these and the test weights from the scale. With all weight removed, press **ENTER** to rezero the scale. This function adjusts the zero and span calibration values. The indicator displays °CAL° while the zero and span calibrations are adjusted. When complete, the adjusted A/D count for the zero calibration is displayed. Press **ENTER** again to save the rezero value and return to the **REZERO** prompt or use the procedure shown in Figure 4-2 to edit the value. When done, press **RIGHT** to return to the CALIBR menu.
7. Press the setup switch to exit setup mode.

4.2 EDP Command Calibration

To calibrate the indicator using EDP commands, the indicator EDP port must be connected to a terminal or personal computer. See Section 5.0 on page 28 for more information about using EDP commands. Once the indicator is connected to the sending device, do the following:

1. Place the indicator in setup mode (display reads **CONFIG**) and remove all weight from the scale platform. If your test weights require hooks or chains, place the hooks or chains on the scale for zero calibration.
2. Send the WZERO EDP command to calibrate zero. The indicator displays °CAL° while calibration is in progress.
3. Send the WVAL command to enter the test weight value in the following format:
WVAL=nnnnnn<CR>
4. Place test weights on scale equal to the specified WVAL.
5. Send the WSPAN EDP command to calibrate span. The indicator displays °CAL° while calibration is in progress.
6. To remove an offset value, clear all weight from the scale, including hooks or chains used to hang test weights, then send the REZERO EDP command. The indicator displays °CAL° while the zero and span calibrations are adjusted.
7. Send the KEXIT EDP command to exit setup mode.

4.3 Revolution™ Calibration

To calibrate the indicator using Revolution, the indicator must be in setup mode with the EDP port connected to a PC running the Revolution configuration utility. Use the following procedure to calibrate the indicator:

1. Select **Calibrate Indicator** from the Revolution main menu.
2. On the Weight Calibration display, select the indicator model (**IQ+210**) and communications port then click **OK**.
3. Revolution uploads calibration data from the indicator then presents the information in a display like that shown in [Figure 4-3](#).
4. Enter the **Value of Test Weight** to be used for span calibration then click **OK**.
5. The Zero Calibration dialog box prompts you to remove all weight from the scale. Clear the scale and click **OK** to begin zero calibration.



NOTE: If your test weights require hooks or chains, place the hooks or chains on the scale for zero calibration.

6. When zero calibration is complete, the Span Calibration dialog box prompts you to place test weights on the scale for span calibration. Place test weights on the scale then click **OK**.
7. The Rezero dialog box prompts you to remove all weight, from the scale (including hooks or chains). Remove the weights then click **OK**.
8. When calibration is complete, the **New Settings** fields of the Weight Calibration display are filled in. Click **Exit** to save the new values and return to the Revolution main menu; to restore the previous calibration values, click **Restore Settings**.

Current Settings	New Settings
Zero: 108667.	Zero:
Value: 10000.	Value:
Span: 528683.	Span:

Calibration Status

- ☐ Zero calibration finished
- ☐ Test weight applied
- ☐ Span calculation finished
- ☐ Load removed from scale
- ☐ Rezero calibration finished

Value of Test Weight:

Start Help Restore Settings Exit

Figure 4-3. Revolution Calibration Display

5.0 EDP Commands

The IQ Plus 210 indicator can be controlled by a personal computer or remote keyboard connected to the indicator serial port. Control is provided by a set of EDP commands that can simulate front panel key press functions, display and change setup parameters, and perform reporting functions. The EDP port provides the capability to print configuration data or to save that data to an attached personal computer. This section describes the EDP command set and procedures for saving and transferring data using the serial port.

5.1 The EDP Command Set

The EDP command set can be divided into five groups: key press commands, reporting commands, the RESETCONFIGURATION special function command, parameter setting commands, and transmit weight data commands.

When the indicator processes an EDP command, it responds with the message **OK**. The **OK** response verifies that the command was received and has been executed. If the command is unrecognized or cannot be executed, the indicator responds with **??**.

The following sections list the commands and command syntax used for each of these groups.

5.1.1 Key Press Commands

Key press EDP commands (see [Table 5-1](#)) simulate pressing the buttons on the front panel of the indicator.

Command	Function
KZERO	Press the ZERO button
KUNITS	Press the UNITS button
KPRIM	Display primary units
KPRINT	Send demand data to serial port
KRIGHTARROW	In setup mode, move right in the menu (press the UNITS button)
KENTER	In setup mode, press the ENTER (ZERO) button
KEXIT	In setup mode only, exit setup mode

Table 5-1. EDP Key Press Commands

5.1.2 Reporting Commands

Reporting commands (see [Table 5-2](#)) send specific information to the EDP port. These commands can be used in both setup mode and normal mode.

Command	Function
DUMPALL	List all parameter values
VERSION	Write IQ Plus 210 software version
P	Write current displayed weight.
ZZ	Write current weight and annunciator status.
RS	Reset the indicator
S	Write one frame of stream format

Table 5-2. EDP Reporting Commands

5.1.3 The RESETCONFIGURATION Command

The RESETCONFIGURATION command can be used to restore all configuration parameters to their default values.

This command is equivalent to using the RESET function on the DEFLT menu.



NOTE: All load cell calibration settings are lost when the RESETCONFIGURATION command is run.

5.1.4 Parameter Setting Commands

Parameter setting commands allow display or change to the value for a configuration parameters (Tables 5-3 through 5-8).

Current configuration parameter settings can be displayed in either setup mode or normal mode using the following syntax:
`command<ENTER>`

Most parameters can only be changed in setup mode. Use the following command syntax when changing parameter values:
`command=value<ENTER>`

where **value** is a number or a parameter value. Use no spaces before or after the equal (=) sign. If you type an incorrect command or value, the display reads **??**. Changes to the parameters are saved as they are entered but typically do not take effect until you exit setup mode.

For example, to set the motion band parameter to 5, type the following:

`MOTBAND=5D<ENTER>`

Command	Description	Values
GRADS	Graduations	1–10 000
ZTRKBN	Zero track band	OFF, 0.5D, 1D, 3D
ZRANGE	Zero range	1.9%, 100%
MOTBAND	Motion band	1D, 2D, 3D, 5D, 10D, 20D, OFF
OVRLD	Overload	FS+2%, FS+1D, FS+9D, FS
FILTER	Digital filtering	1, 2, 4, 8, 16, 4RT, 8RT, 16RT

Table 5-3. CONFIG EDP Commands

Command	Description	Values
PRI.DCPNT	Primary units decimal position	8.88888, 88.8888, 888.888, 8888.88, 88888.8, 888888, 888880 (88 88.8 or 888 88 in LB/OZ display mode)
PRI.DSPDIV	Primary units display divisions	1D, 2D, 5D
PRI.UNITS	Primary units	LB, KG, OZ, G, LB/OZ
ALT.LB ALT.KG ALT.OZ ALT.G ALT.LBOZ	Enable alternate units	ON, OFF

Table 5-4. FORMAT EDP Commands

Command	Description	Values
WZERO	Zero calibration	—
WVAL	Test weight value	test_weight_value
WSPAN	Span calibration	—
REZERO	Rezero	—
LC.CD	Set deadload count	value
LC.CW	Set span count	value

Table 5-5. CALIBR EDP Commands

Command	Description	Values
EDP.BAUD	Serial port baud rate	1200, 2400, 4800, 9600
EDP.BITS	Serial port data bits/parity	8NONE, 7EVEN, 7ODD
EDP.TERMIN	Serial port termination character	CR/LF, CR
EDP.ECHO	Serial port echo command	OFF, ON
PRNFREQ	Print frequency	DEMAND, AUTO1, AUTO2, STREAM

Table 5-6. SERIAL EDP Commands

Command	Description	Values
DIGIN1 DIGIN2	Digital input function	OFF, ZERO, UNITS, PRINT

Table 5-7. DIG IN EDP Commands

5.1.5 Normal Mode Commands

The serial transmit weight data commands (see [Table 5-8](#)) transmit data to the serial port on demand. The transmit weight data commands are valid only in normal operating mode.

Command	Description	Response Format
SX	Start serial streaming	OK or ??
EX	Stop serial streaming	OK or ??
RS	Reset system	—
XG	Transmit gross weight in displayed units	nnnnnn UU where nnnnnn is the weight value, UU is the units.
XGL	Transmit gross weight in pounds	
XGK	Transmit gross weight in kilograms	
XGO	Transmit gross weight in ounces	
XGG	Transmit gross weight in grams	
XGC	Transmit gross weight in pounds and ounces	nnnnn nnnnn
XE	Query system error conditions	

Table 5-8. Normal Mode EDP Commands

5.2 Saving and Transferring Data

Connecting a personal computer to the IQ Plus 210 EDP port allows you to save indicator configuration data to the PC or to download configuration data from the PC to an indicator. The following sections describe the procedures for these save and transfer operations.

5.2.1 Saving Indicator Data to a Personal Computer

Configuration data can be saved to a personal computer connected to the EDP port. The PC must be running a communications program such as PROCOMMPLUS®.

When configuring the indicator, ensure that the values set for the BAUD and BITS parameters on the SERIAL menu match the baud rate, bits, and parity settings configured for the serial port on the PC.

To save all configuration data, send the DUMPALL EDP command to the indicator. The IQ Plus 210 responds by sending all configuration parameters to the PC as ASCII-formatted text.

5.2.2 Downloading Configuration Data from PC to Indicator

Configuration data saved on a PC or floppy disk can be downloaded from the PC to an indicator. This procedure is useful when a number of indicators with similar configurations are set up or when an indicator is replaced.

To download configuration data, connect the PC to the EDP port as described in [Section 5.2.1](#). Place the indicator in setup mode and use the PC communications software to send the saved configuration data to the indicator. When transfer is complete, calibrate the indicator as described in [Section 4.0 on page 25](#).



NOTE: Calibration settings are included in the configuration data downloaded to the indicator. If the receiving indicator is a direct replacement for another IQ Plus 210 and the attached scale is not changed, recalibration is not required.

When downloading configurations that include changed serial communications settings, edit the data file to place the serial communications changes at the end of the file. Communication between the PC and indicator will be lost once the indicator receives settings for baud rate (BAUD parameter) or data bits and parity (BITS parameter) that do not match those configured for the PC.

6.0 Appendix

6.1 Error Messages

The IQ Plus 210 indicator provides a number of error messages. When an error occurs, the message is shown on the indicator LED display. Error conditions can also be checked remotely by using the XE EDP command as described in [Section 6.1.2](#).

Error Message	Description	Solution
E A/D	A/D physical error	Call Rice Lake Weighing Systems (Rice Lake Weighing Systems) Service.
EEEROM	EEPROM physical error	
EVIREE	Virgin EEPROM	Use the DEFLT menu to restore defaults, then recalibrate load cells.
EPCKSM	Parameter checksum error	
EACKSM	A/D calibration checksum error	A/D converter requires recalibration. Call Rice Lake Weighing Systems Service.
ELCKSM	Load cell calibration checksum error	
EIDATA	Internal RAM checksum error	Call Rice Lake Weighing Systems Service.
INOVFL	Internal overflow error	Remove weight from scale. If error recurs, check configuration, check scale for damage.
OVERFL	Overflow error	Weight value too large to be displayed.
-----	Gross > overload limit	Gross value exceeds overload limit. Check configuration.
-----	A/D underrange	A/D reading < -4 mV. Check scale for binding or damage.

Table 6-1. IQ plus 210 Error Messages

6.1.1 Displayed Error Messages

The IQ Plus 210 provides a number of front panel error messages to assist in problem diagnosis. Table 6-1 lists these messages and their meanings.

6.1.2 Using the XE EDP Command

The XE EDP command can be used to remotely query the IQ Plus 210 for the error conditions shown on the front panel. The XE command returns two 5-digit numbers in the format:

xxxxx yyyyy

where xxxxx contains a decimal representation of any existing error conditions as described in Table 6-2.

If more than one error condition exists, the number returned is the sum of the values representing the error conditions. For example, if the XE command returns the number 528, this value represents the sum of an A/D physical error (512) and an A/D calibration checksum error (16).

The second number returned (yyyyy) uses the same bit assignments as shown in Table 6-2 to indicate whether the test for the error condition was run. For example, the value yyyyy = 51807 represents the decimal equivalent of the binary value 1100 1110 0111 1111. Using the bit assignments in Table 6-2, this value indicates all tests were run.

Error Code	Description	Binary Value
0	No error	0000 0000 0000 0000
1	EEPROM physical error	0000 0000 0000 0001
2	Virgin EEPROM	0000 0000 0000 0010
4	Parameter checksum error	0000 0000 0000 0100
8	Load cell calibration checksum error	0000 0000 0000 1000
16	A/D calibration checksum error	0000 0000 0001 0000
32	not assigned	0000 0000 0010 0000
64	Internal RAM checksum error	0000 0000 0100 0000
128	not assigned	0000 0000 1000 0000
256	not assigned	0000 0001 0000 0000
512	A/D physical error	0000 0010 0000 0000

Table 6-2. Error Codes Returned on XE Command

Error Code	Description	Binary Value
1024	not assigned	0000 0100 0000 0000
2048	Internal overflow error	0000 1000 0000 0000
4096	not assigned	0001 0000 0000 0000
8192	not assigned	0010 0000 0000 0000
16384	A/D underrange	0100 0000 0000 0000
32768	Gross > overload limit	1000 0000 0000 0000

Table 6-2. Error Codes Returned on XE Command (Continued)

6.2 Status Messages

Two EDP commands, P and ZZ, can be used to provide status about the indicator. These commands are described in the following sections.

6.2.1 Using the P EDP Command

The P EDP command returns the current displayed weight value to the EDP port. If the indicator is in an under range or overload condition, the weight value is replaced with &&&&& (overload) or : : : : : (under range).

6.2.2 Using the ZZ EDP Command

The ZZ EDP command can be used to remotely query which annunciators are currently displayed on the indicator front panel. The ZZ command returns the currently displayed weight and a decimal number representing the LED annunciators currently lit. The format of the returned data is:

wwwwww zzz

where **wwwwww** is the current displayed weight, **zzz** is the annunciator status value (see Table 6-3). If more than one annunciator is lit, the second number returned is the sum of the values representing the active annunciators. For example, if the annunciator status value returned on the ZZ command is 136, the center of zero and lb annunciators are lit: 136 represents the sum of the values for the center of zero annunciator (128) and the lb annunciator (8).

Decimal Value	Annunciator
1	Reserved
2	Negative value
4	oz
8	lb
16	g
32	kg

Table 6-3. Status Codes Returned on the ZZ Command

6.3 Continuous Output (Stream) Format

Figure 6-1 shows the continuous output format sent to the IQ Plus 210 EDP or printer port when the STREAM parameter (SERIAL menu) is set to either EDP or PRN.

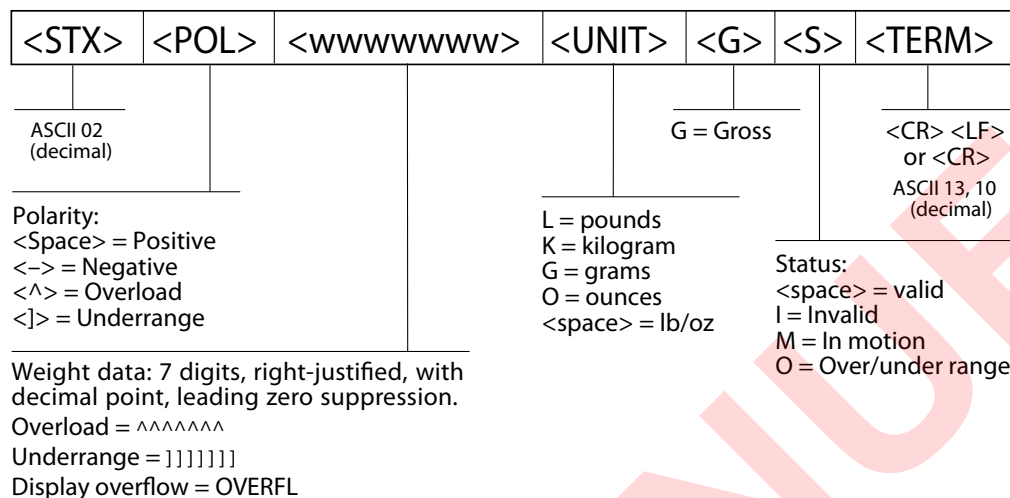


Figure 6-1. Continuous Output Data Format

6.4 Cable Specifications

Cord Grip	Diameter Range
PG9 (PN 15626)	0.138 - 0.315" (3.5 - 8 mm)

Table 6-4. Cord Grip Specifications

Connector	Torque
Around cables	22 in-lb
Cord grip to enclosure	33 in-lb

Table 6-5. Cord Grip Torque Specifications

6.5 Specifications

Power

Line Voltages	115 or 230 VAC
Frequency	50 or 60 Hz
Power Consumption	70 mA @ 115 VAC (8W) 35 mA @ 230 VAC (8W)
Fusing	
115 VAC	2 x 200 mA TR5 subminiature fuses Wickmann Time-Lag 19374 Series UL Listed, CSA Certified
230	VAC 2 x 100 mA TR5 subminiature fuses Wickmann Time-Lag 19372 Series UL Recognized, VDE Approved

Analog Specifications

Full Scale Input Signal	Up to 35 mV
Excitation Voltage	10 $\pm$ 0.25 VDC, 4 x 350 Ω load cells
Analog Signal	
Input Range	0.6 mV/V – 4.5 mV/V
Analog Signal	
Sensitivity	0.3 μ V/graduation minimum, 1.5 μ V/grad recommended
Input Impedance	200 M Ω , typical
Display Resolution	10 000 dd
Input Sensitivity	155 nV per internal count
System Linearity	Within 0.01% of full scale
Calibration Method	Software, constants stored in EEPROM
Common Mode	
Voltage	–1.05 to +0.95 V, referred to earth
RFI Protection	Signal, excitation, and sense lines protected by capacitor bypass

Digital Specifications

Digital Inputs	2 inputs, TTL or switch closure, active-low
Digital Filter	Software selectable

Serial Communications

Serial Port	Full duplex RS-232; 9600, 4800, 2400, 1200 bps; 7 or 8 data bits; even, odd, or no parity
-------------	---

Operator Interface

Display	6-digit LED display. 7-segment, .8 in (20 mm) digits
LED annunciators	Negative value, center of zero, motion, kg, g, lb, oz
Keypad	2 piezo switches

Environmental

Operating Temperature	–10 to +40°C (legal); –10 to +50°C (industrial)
Storage Temperature	–25 to +70°C
Humidity	0–95% relative humidity
Altitude	2000 m (6500 ft) maximum

Enclosure

Enclosure Dimensions	9.5 in x 6 in x 2.75 in 24 cm x 15 cm x 7 cm
Weight	6.1 lb (2.8 Kg)
Rating/Material	NEMA 4X indoor use only, stainless steel

Approvals



NTEP

CoC Number	00-045
Accuracy Class	III/III L



UL

File Number	E151461
-------------	---------



Measurement Canada Approved

Approval	AM-5374
Accuracy Class	III/III HD



The IQ210 complies with Part 15 of the FCC Rules. Operation is subject to the following conditions:

- This device may not cause harmful interference.
- This device must accept any interference received, including interference that may cause undesired operation.

DISCONTINUED

DISCONTINUED



© Rice Lake Weighing Systems Content subject to change without notice.

230 W. Coleman St. • Rice Lake, WI 54868 • USA USA: 800-472-6703 • International: +1-715-234-9171